
Floor level




Engine compartment:
Cowl: Treat via existing holes and from sides. Treat on top of longitudinal member, reinforcements on spring struts, 2 engine suspensions, battery box and locking plate. See fig 3 for correct drilling and treatment of top member in wing.



Bonnet lid: Treat via existing holes and gaps.

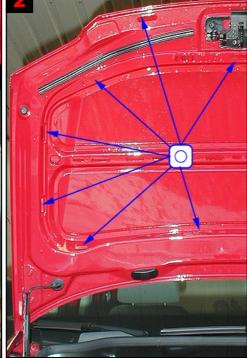


B-pillar and rear wing: Treat via 2 holes for correct treatment.

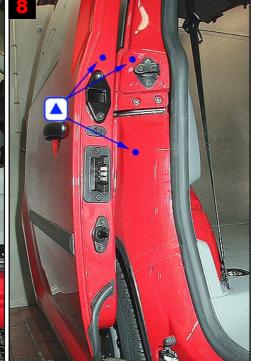


C-pillar and sliding door: C-pillar: Treat via 2 drilled holes. Sliding door: Drill 1 hole for correct treatment. Drill 1 hole 5 cm. above lock mounting.



Sliding door rear: Treat via existing plugged holes (mind devider!).

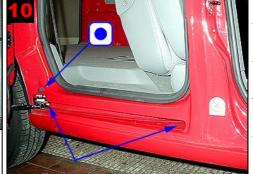


Slide rail for sliding door: Treat via existing gaps. Treat via existing plugged hole.

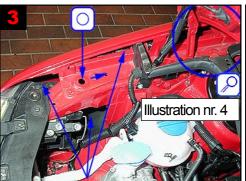


Engine compartement - sectional view: Fig: correct treatment of top member in wing and engine compartement. See fig. 4 for correct drilling level.




Engine compartement - sectional view: Fig: drilling at correct level.

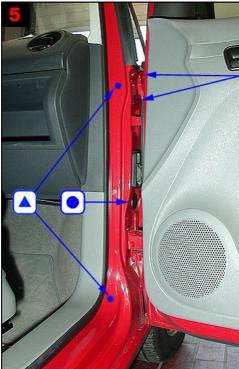


A-pillar/front wing:
A-pillar: Treat via 2 drilled holes as well as via existing plugged hole. Front wing: Treat with lance from clearing between A-pillar and wing.

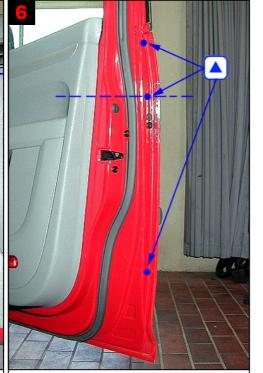


Front door: Treat via 3 drilled holes for correct treat-ment. 2nd. drilling level just above child-proof locking device.

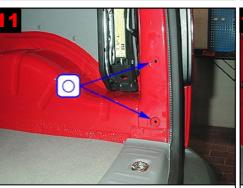


D-pillar/rear panel: Treat via existing holes.

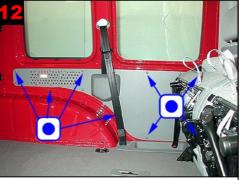

Lining. Treatment via existing plugged holes (clips).

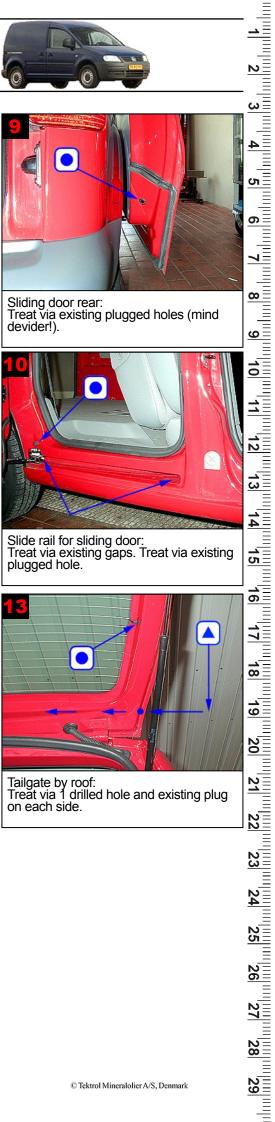

Tailgate by roof: Treat via 1 drilled hole and existing plug on each side.

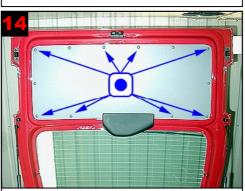

Tailgate by bumper: Treatment via existing plugged holes















Zoom on detail










Underside

VW Caddy


Model 2004

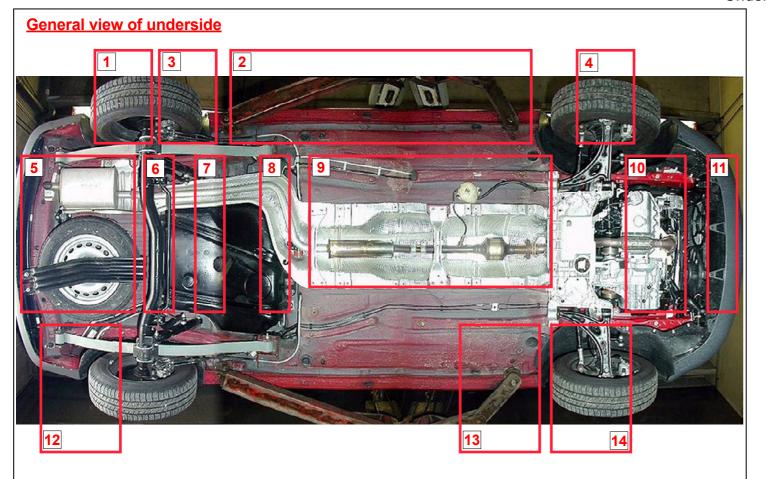

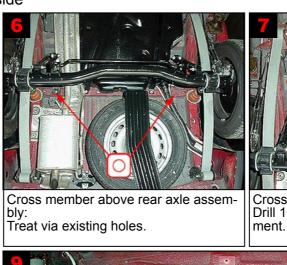

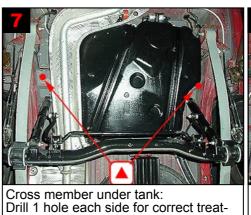


Cross member before tank: Treat via existing holes.

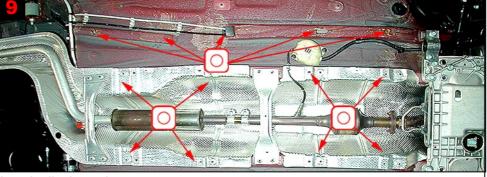




Longitudinal members centre: Treat via existing holes. Treatment via existing holes behind cover plate.


Longitudinal members front: Treat via existing holes.

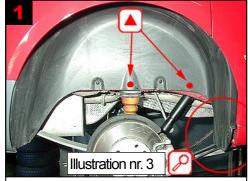


Wheel arch rear: Treatment via 2 drill holes and behind wheel arch liner where possible.

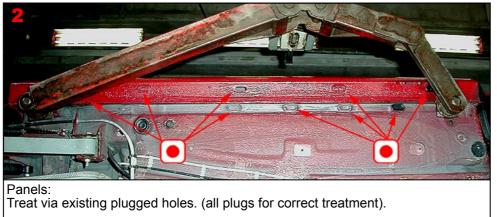

U-member behind radiator: Caution when treating from sides.

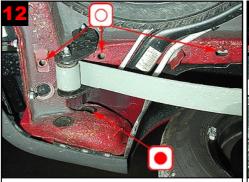


Longitudinal member and rear panel: Treatment via existing and plugged hole

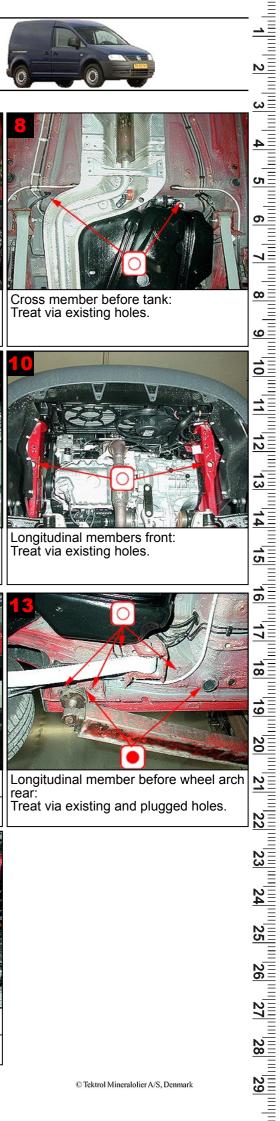

Longitudinal member before wheel arch

Treat via existing and plugged holes.

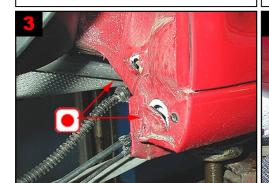


Wheel arch rear/panel: Treatment via 2 plugged holes.

VOLKSWAGEN



Wheel arch front/panel: Treat via existing plugged hole.

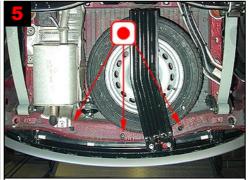

Rear panel/U-member by bumber: Rear panel: Treat via existing holes. U-member behind bumper: Treat via gap between bumper and panel.



Small cross member after front wheel Treat via existing plugged hole.



Longitudinal members front: Reinforcements: Treat via existing holes.

















